



**Zimmer & Rohde GmbH**  
**Zimmersmühlenweg 14 18**  
**61440 OBERURSEL**  
**Germany**

**Your notice of**  
10-08-2022

**Your reference**

**Date**  
07-09-2022

## Analysis Report 22.04300.01

Required tests :

**EN 13773 (2003)**

| Sample id | Information given by the client | Date of receipt |
|-----------|---------------------------------|-----------------|
| T2216075  | 10720                           | 10-08-2022      |

Mike De Vrieze  
Order responsible

This report may be reproduced, as long as it is presented in its entire form, without written permission of Centexbel.  
The results of the analysis cover the received samples. Centexbel is not responsible for the representativeness of the samples.  
In assessing compliance with the specifications, we did not take into account the uncertainty on the test results.



**Reference: T2216075 - 10720**

**Textiles – Burning behaviour – Curtains and drapes - Textile fabrics - Determination of the ignitability of vertically oriented specimens.**


Date of ending the test 02-09-2022  
 Standard used EN 1101 (1995) + A1 (2005)  
 Product standard EN 13773 (2003)  
  
 Deviation from the standard -  
  
 Conditioning 20°C, relative humidity 65%  
  
 Ignition Bottom edge

The test specimens have not been cleaned nor submitted to an accelerated ageing procedure.

**Length**

| Flame application time (s) | Cases of ignition | Cases of non-ignition |
|----------------------------|-------------------|-----------------------|
| 1                          | 0                 | 1                     |
| 2                          | 0                 | 1                     |
| 3                          | 0                 | 1                     |
| 4                          | 0                 | 1                     |
| 5                          | 0                 | 1                     |
| 10                         | 0                 | 1                     |
| 15                         | 0                 | 1                     |
| 20                         | 0                 | 5                     |

The mean of the recorded times at which ignition was observed is calculated  
 No ignition within 20 s

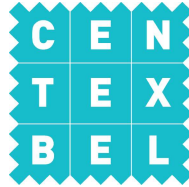

Width

| Flame application time (s) | Cases of ignition | Cases of non-ignition |
|----------------------------|-------------------|-----------------------|
| 1                          | 0                 | 1                     |
| 2                          | 0                 | 1                     |
| 3                          | 0                 | 1                     |
| 4                          | 0                 | 1                     |
| 5                          | 0                 | 1                     |
| 10                         | 0                 | 1                     |
| 15                         | 0                 | 1                     |
| 20                         | 0                 | 5                     |

The mean of the recorded times at which ignition was observed is calculated  
 No ignition within 20 s

**Reference: T2216075 - 10720**

**Textiles and textile products – Burning behaviour – Curtains and drapes. Measurement of flame spread of vertically oriented specimens with large ignition source.**

Date of ending the test 05-09-2022  
 Standard used EN 13772 (2011)  
 Product standard EN 13773 (2003)

Deviation from the standard -

Conditioning 20°C, relative humidity 65%

The test specimens have not been cleaned nor submitted to an accelerated ageing procedure.

**Length**

|  | Face A | Face B | Face B | Face B |
|--|--------|--------|--------|--------|
| Severance 1 <sup>st</sup> thread         | no     | no     | no     | no     |
| Severance 2 <sup>nd</sup> thread         | no     | no     | no     | no     |
| Severance 3 <sup>rd</sup> thread         | no     | no     | no     | no     |
| Time to sever 3 <sup>rd</sup> thread (s) | /      | /      | /      | /      |
| Destroyed length (mm)                    | 125    | 130    | 115    | 125    |
| Flaming debris                           | no     | no     | no     | no     |

**Width**

|  | Face A | Face B | Face A | Face A |
|--|--------|--------|--------|--------|
| Severance 1 <sup>st</sup> thread         | no     | no     | no     | no     |
| Severance 2 <sup>nd</sup> thread         | no     | no     | no     | no     |
| Severance 3 <sup>rd</sup> thread         | no     | no     | no     | no     |
| Time to sever 3 <sup>rd</sup> thread (s) | /      | /      | /      | /      |
| Destroyed length (mm)                    | 135    | 125    | 115    | 125    |
| Flaming debris                           | no     | no     | no     | no     |

**Classification in accordance with EN 13773 Class 1**